

Training Package
TP 08/11

Recent Incidents in the Gases Industry in Asia



Asia Industrial Gases Association

3 HarbourFront Place #09-04 HarbourFront Tower 2
Singapore 099254 Internet: <http://www.asiaiga.org>

Recent Incidents in Gases Industry

Disclaimer

All publications of AIGA or bearing AIGA's name contain information, including Codes of Practice, safety procedures and other technical information that were obtained from sources believed by AIGA to be reliable and/ or based on technical information and experience currently available from members of AIGA and others at the date of the publication. As such, we do not make any representation or warranty nor accept any liability as to the accuracy, completeness or correctness of the information contained in these publications.

While AIGA recommends that its members refer to or use its publications, such reference to or use thereof by its members or third parties is purely voluntary and not binding.

AIGA or its members make no guarantee of the results and assume no liability or responsibility in connection with the reference to or use of information or suggestions contained in AIGA's publications.

AIGA has no control whatsoever as regards, performance or non performance, misinterpretation, proper or improper use of any information or suggestions contained in AIGA's publications by any person or entity (including AIGA members) and AIGA expressly disclaims any liability in connection thereto.

AIGA's publications are subject to periodic review and users are cautioned to obtain the latest edition.

© AIGA 2011- Asia Industrial Gases Association. All rights reserved.

Introduction

At the regular Safety Advisory Group (SAG) meetings, members exchange information on accidents/incidents that have occurred . Accident/Incident details discussed at the SAG remain confidential.

The SAG has decided to share the more notable accidents/incidents on a regular basis with the national associations and member companies via the Training Package publications.

These slides contain the summaries, pictures and other relevant information to highlight the root causes and lessons to be learned.

Further Information:

These Training Packages are posted only on the Members Page and are meant for distribution among Members only.

While the best effort is made to provide sufficient information on the accidents/incidents, please contact the SAG (through the Secretary General) if you need further clarifications.

Case 1

Fatality accident during underground pipeline construction

What happened

- Underground O2 & N2 pipelines construction work was in progress on site from February 2011.
- To protect the pipelines under construction against ingress of humid air outside of working hours and during rainy periods, it was decided to plug the open ends with mechanical caps and inert the pipelines with nitrogen at 1 bar (g). The pipelines would be de-pressurized before work resumed.
- On 9 March 2011 after rain had stopped at around 5.30 pm two workers from the subcontractor company were in the trench doing housekeeping when the cap on the N2 pipeline suddenly came off. The ejected cap struck one of the workers in the trench and he was thrown off some 14 metres away.
He suffered multiple injuries and died three hours later at the hospital.
- The other worker suffered slight injury on his back.

Pipeline and blank cap

The blank cap used to blind off the open-end of the pipeline uses a compressed rubber ring fitting design that is supposed to hold a pressure of up to 3 bar(g).

When the incident occurred the N2 pressure had probably risen to 7 bar (g) due to a malfunction of the pressure regulator used to regulate the pressure from the source.



**N2 pipeline cap
and O2 pipeline**



**Location of
the accident**

Pipeline Cap and Assembling Process

Note: Pictures taken after the accident

1



2



3



4



5



6



Root causes

- **Blank cap design pressure exceeded**
The blank cap used to seal off the open-end of the pipeline under construction was specified as *'to be able to hold a pressure of 3 bar'*. The pressure in the line was supposed to be maintained at 1 bar(g). Failure probably occurred when the pressure reached 7 bar (g).
- **Failure of pressure regulator**
The upstream pressure before the regulator was in excess of 20 bar (g). The regulator's malfunction resulted in a much higher pressure in the pipeline section.
- **No protection for over-pressure in the pipeline**
No pressure relief protection was installed to prevent the pipeline from exceeding the intended pressure.

Lessons to be learned

- Work Permit procedure – Was this well understood and correctly administered ?
- Management of Change – Was a risk assessment done for use of high pressure nitrogen regulated down to low pressure ?
- Necessity to inert pipeline?
Was there a need to inert pipelines under construction and was there a need to have a pressure in the pipeline?

Note:

AIGA 021/05 – ‘Oxygen pipeline systems’ refers to pipeline cleanliness as follows:


‘6.5.5 Sealing, purging and monitoring

Following the pipeline inspection and acceptance of the standard of cleanliness, the pipeline will be sealed at all open ends with either welded caps or blind flanges and purged with dry, oil-free air or nitrogen (dew point no higher than 40°C) until the dew points of the inlet and exit gas are essentially the same.’

This applies to preservation of completed pipeline awaiting commissioning.

Things to consider:

Don't start work without a Permit-to-Work (reference AIGA 011/04)

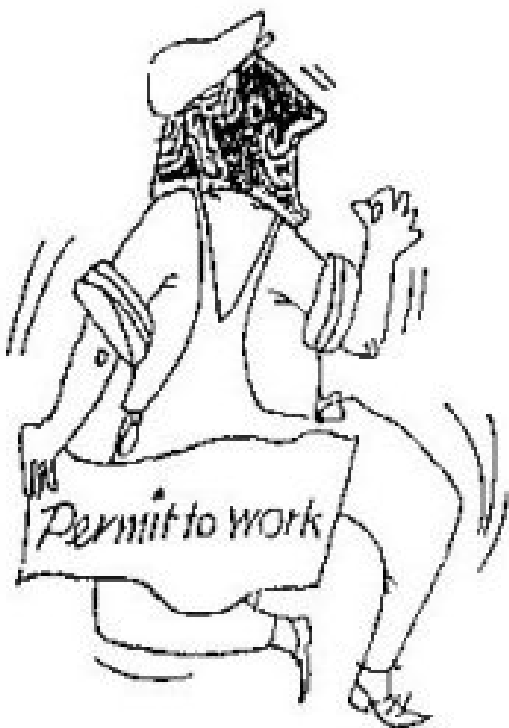

Appendix 1 EIGA/IGC		WORK PERMIT		n°	
Any attached document or log sheet ?		YES	NO	HOW MANY	
List of attached documents					
1. WORK ACTIVITY					
Plant / Unit :					
Description of work to be done					
Permit valid from		Hours/date	To	Hours/date	
Have all relevant departments/personnel been consulted ?		YES	NOT APPLICABLE		
2. POTENTIAL HAZARDS & HAZARDOUS JOBS					
		YES	NO	YES NO	
. Jobs performed by contractors or temporary workers				. Maintenance or repairs in areas, or to equipment or lines, containing or supposed to contain hazardous materials or conditions	
. Potential oxygen deficiency or enrichment				. Manual or powered excavations	
. Potential flammable / explosive atmosphere				. Use of mobile cranes	
. Potential high temperature / pressure				. Insulation or catalyst handling	
. Potential exposure to hazardous chemicals (toxic, reactive, acid, caustic....)				. Use of adapters	
. Confined space entry				. Product conversion of stationary or mobile or portable vessels and containers	
. Bypassing or removing/altering safety devices and equipment				. Temporary or permanent changes, alterations, modifications of equipment or processes	
. Elevated work				. Exposure to traffic (road, mail)	
. Introduction of ignition sources where not permanently allowed (fire permit)				. Exposure to moving / rotating machinery	
. Electrical troubleshooting or repair on live circuits					
Others (state)					
3. SAFETY PRECAUTIONS					
		YES	NO	YES	NO
. Draining				. Standby man	
. Depressurising				. Elevated work	
. Physical Isolation				. Contractors trained	
. Electrical Isolation				. Eliminate ignition sources	
. Safety tags and locks				. Fire hose	
. Flushing with water/solvent				. Fire screen	
. Steaming out				. Wet surrounding area	
. Purging with inert gas/air				. Audible/visible warnings	
. Temperature normalisation				. Clear area of combustibles	
				Fire extinguishers	

Things to consider:

Is MOC(Management of Change) required?

- To ensure that safety, reliability & quality of process is maintained
- To manage the entire change from start to finish
- Compliance with company procedures and standards

Reference from AIGA 010/04 – Management of Change

MANAGEMENT OF CHANGE PROCEDURE

Location : Date : Product:

Modification description : Equipment : 0 new 0 modified 0 relocated

Process : 0 change 0 extension 0

Max/Min pressure: Max/Min temp :

Chemical react. : Misc. (toxic) :


Check off all items carefully. Use enclosed MOC Guideline.

Case 2

Rollover of liquid carbon dioxide tank trailer

What happened

- A fully loaded liquid CO₂ tank-trailer was on its way to deliver the product to the customer at around 5 pm on a Sunday. Traffic condition was light. The vehicle had approached the entrant ramp to an elevated road intersection at a speed of 57km/hr (as recorded by the GPS Black Box). At the curve section of the slip road to the ramp the speed was recorded as 45 km/hr. The driver suddenly lost control of the vehicle and the tank trailer rolled over and hit the roadside guard.
- Due to the impact, some portion of polyurethane insulation foam on the tank broke out and pushed against a gas valve handle (quick opening type valve). The valve was thus opened and resulted in some LCO₂ release.
- The emergency response team arrived at the accident scene later and was able to stop the release safely.
- The driver had his seatbelt on and received slightly injury on his face due to the broken windscreen. He received first-aid treatment at a nearby hospital.
- Total liquid CO₂ release - around 3 tons.
- Estimated repair cost to tanker - US\$ 42,000.

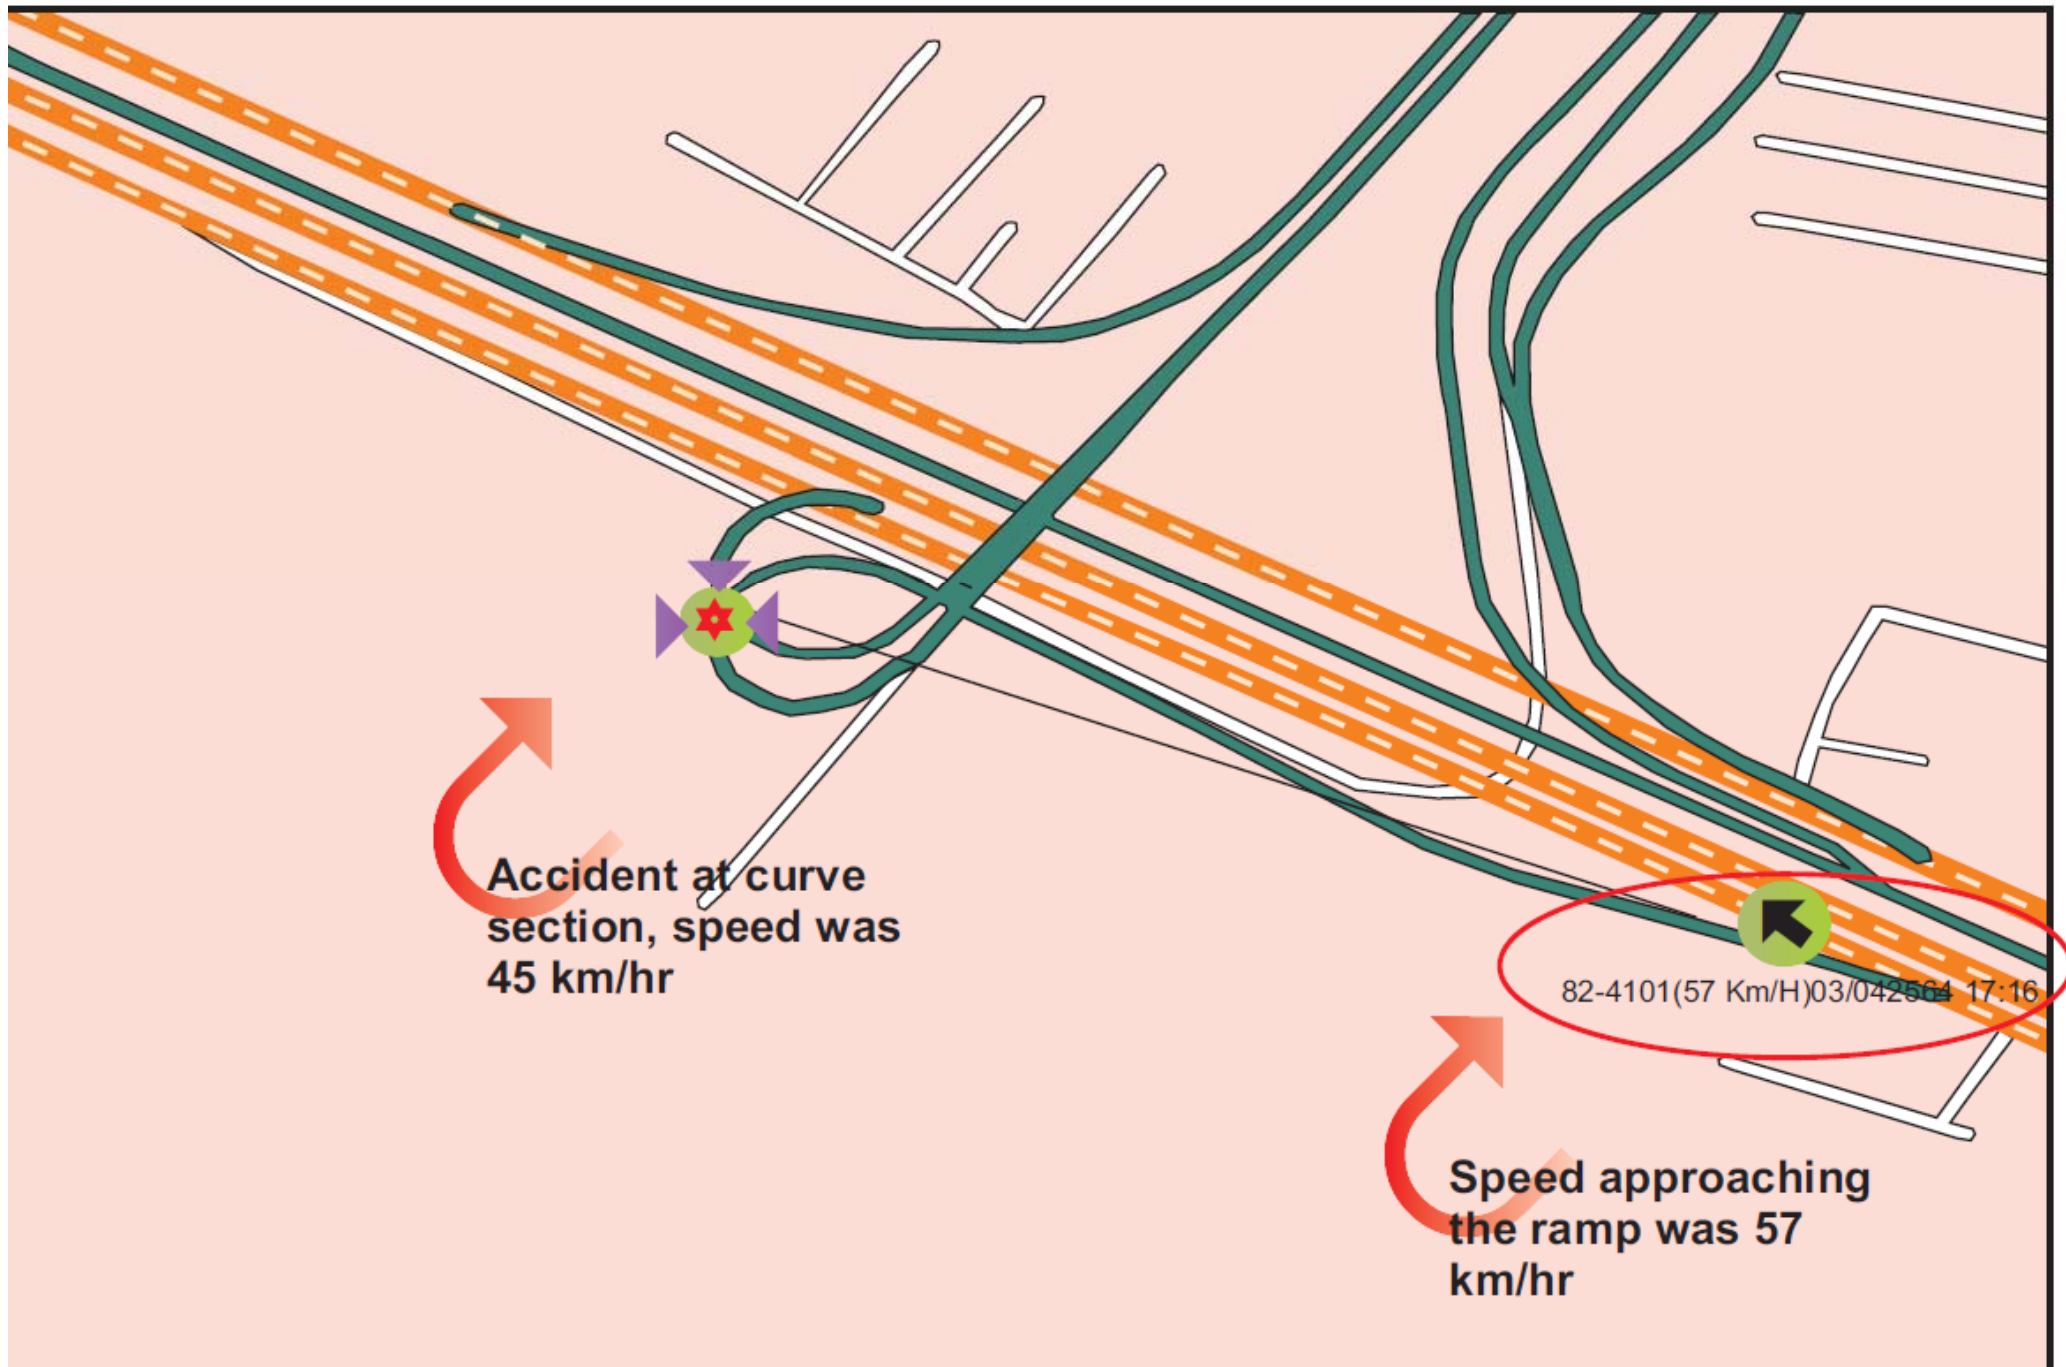

Root Causes

- Safe speed exceeded

The driver was travelling at a higher speed than he should due to the light traffic condition when he was approaching the slip road to the elevated intersection.

- Failure to adopt correct driving technique

He did not slow down sufficiently when he negotiated the curve up the ramp. He had exceeded the speed limit to prevent the rollover from occurring.

- Driver's behaviour

Driver was not fully acquainted with the factors that would trigger off a vehicle rollover. The company had not conducted detailed training on the techniques to prevent rollover incidents.

Lessons learned

- Incident details are shared with drivers – to highlight the data on the actual speeds in the incident and the speed limit which should be adhered to when negotiating a road curve.
- Drivers are reminded to keep to safe speed limit even when traffic condition is light and not to be over confident.
- Company to re-emphasize training for all drivers on the causes of rollover and the driving techniques to prevent it.
- Use of quick opening valves on liquid CO2 tanks should be reviewed as they tend to be opened when there is an impact on the handles in an accident.
- Useful link on rollover prevention:

<http://www.fmcsa.dot.gov/about/outreach/cargo-tank-video.aspx>